



Using the Cut-off Saw

1. Wear protective equipment including goggles and dust mask.
2. Check that the cutting wheel is fitted securely, and that the guard is properly adjusted.
3. Always hold the machine securely with, both hands: left hand on the front handle, right hand on the rear.
4. Be prepared for the reactive force when the wheel contacts the surface to be cut: the machine will pull away from you, or pull up a vertical surface.
5. Use full throttle: make sure the wheel is running at full speed before lowering it carefully onto the surface.
6. If the machine starts to labour and slow down do not force it so hard. Do not overload the machine. Long shallows cuts keeping the wheel speed up are more effective than aggressive pressure.
7. When you come towards the end of the cut, release some of the pressure on the machine and be prepared for it to come free from the material.
8. The machine can only cut in straight lines. Do not try to go round corners.
9. Only use the machine up to shoulder height. Arrange a suitable working platform if you need to cut higher than this.
10. Watch out for signs that vibration from the work may be affecting your hands. If fingers start to tingle or feel numb, take a short break from cutting work. Exercise fingers to encourage blood circulation. Find out more about vibration. **Ask the hire company for a copy of the HAE leaflet no. 2150 – Hand-arm vibration or visit www.hse.gov.uk/vibration**
11. To help prevent vibration affecting hands, operate the machine for shorter periods. Keep hands warm – wearing gloves may help do this.
12. Stop the engine if leaving the machine unattended.
13. If the cut-off saw does not work properly do not attempt to repair it. Contact the hire company.
14. You may want to read this leaflet again. Please keep it safely until you have finished work.



Hae
HIRE ASSOCIATION EUROPE

Hire Association Europe
2450 Regents Court
The Crescent
Birmingham Business Park
Soliuhull B37 7YE

Telephone: 44 (0) 121 380 4600
Fax: 44 (0) 121 333 4109
Email: mail@hae.org.uk
website: www.hae.org.uk

©Copyright Hire Association Europe April 2011

Any unauthorised reproduction – manually or electronically – is STRICTLY prohibited

1. This section describes the starting procedure for most cut-off saws. If the hire company has given you special instructions for the saw, follow them. Otherwise, follow the instructions given below.
2. Press the interlock and the throttle at the same time. Whilst keeping these pressed in, pull the control lever back to the starting position.
3. Now release the throttle, control lever and interlock: lever back to the starting position.
4. Set the choke lever to on. If the engine has run but is still cold, the choke control should be in the off position.
5. If the saw has a decompression valve, set it. The decompression valve need to be set each time a fresh attempt is made to start the engine.
6. Place the cut-off saw squarely on its base plate on the ground. Make sure that the cutting disk is not touching the ground or any obstruction.
7. Hold the saw down firmly, with your left hand on the front handle.
8. With your right hand, pull out the starter handle slowly until you can feel that the starter has engaged touching the ground or any obstruction.
9. Don't pull it too far, or it may break.
10. Guide the cord back into place so that it recoils correctly.
11. If the engine did not start, set the choke control to normal position and the engine will idle. Set the choke control to off.
12. In cold weather, you may need to let the engine warm up by gently opening the throttle, before starting work.
1. Press the interlock and the throttle at the same time. Whilst keeping these pressed in, pull the control lever back to the starting position.
2. Now release the throttle, control lever and interlock: lever back to the starting position.
3. Set the choke lever to the off position.
4. Follow the rest of the instructions from instruction 5 onwards, given in the section starting from cold.

STARTING WHEN WARM

1. No smoking.
2. Use a fresh mixture of two stroke engine oil with petrol. If the hire company has given special instructions on how much oil to use, follow them.
3. Stop the engine and let it cool down.
4. If possible move the machine away from the work area.
5. Clean the filter cap and the area around it to prevent dirt falling into the fuel tank.
6. Shake the fuel can to mix the petrol and oil.
7. Use a funnel when refuelling. Do not spill any fuel on yourself or the machine.
8. Wipe any fuel off the machine.
9. Soaked cloth carefully.
10. If any fuel is spilled on your clothes, change them it up or cover it with soil.
11. Put all fuel caps back on properly, and move the fuel can to a cool, safe place.
1. This section describes the starting procedure for most cut-off saws. If the hire company has given you special instructions for the saw, follow them. Otherwise, follow the instructions given below.
2. Press the interlock and the throttle at the same time. Whilst keeping these pressed in, pull the control lever back to the starting position.
3. Now release the throttle, control lever and interlock: lever back to the starting position.
4. Set the choke lever to on. If the engine has run but is still cold, the choke control should be in the off position.
5. If the saw has a decompression valve, set it. The decompression valve need to be set each time a fresh attempt is made to start the engine.
6. Place the cut-off saw squarely on its base plate on the ground. Make sure that the cutting disk is not touching the ground or any obstruction.
7. Hold the saw down firmly, with your left hand on the front handle.
8. With your right hand, pull out the starter handle slowly until you can feel that the starter has engaged touching the ground or any obstruction.
9. Don't pull it too far, or it may break.
10. Guide the cord back into place so that it recoils correctly.
11. If the engine did not start, set the choke control to normal position and the engine will idle. Set the choke control to off.
12. In cold weather, you may need to let the engine warm up by gently opening the throttle, before starting work.
1. Press the interlock and the throttle at the same time. Whilst keeping these pressed in, pull the control lever back to the starting position.
2. Now release the throttle, control lever and interlock: lever back to the starting position.
3. Set the choke lever to the off position.
4. Follow the rest of the instructions from instruction 5 onwards, given in the section starting from cold.

STARTING WHEN COLD

Before Starting Work...




Cut-off (Abrasive) Saw

The rules and procedures in force where people are at work may require the person responsible for this equipment to carry out a specific risk assessment.

It is important to read all of this leaflet BEFORE you use the Cut-off Saw

1. Plan your work and think ahead to make sure you will always be working safely.
2. Petrol mixture is highly flammable. Take care not to cause a fire or explosion.
3. This cut-off saw is designed to cut concrete, masonry, asphalt, steel, cast iron and similar materials using the appropriate abrasive or diamond wheel. Do not use it for anything else. Carelessness or misuse could cause a serious or fatal accident.
4. This machine will damage property if it is not used carefully. Practice on some scrap material if you have not used it before.
5. Make sure that there are no hidden electricity cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
6. The following items of personal protective equipment must be worn: goggles; dust mask - a minimum of FFP3 protection; ear muffs or plugs giving protection to reduce exposure to 87dB(A) at the ear; Safety boots; industrial gloves.
7. A personal first-aid kit should be available.
8. This machine must not be used by young persons, or by anyone under the influence of drugs or alcohol.
9. This machine is designed for operation by an able bodied adult. Anyone with either temporary or permanent disability must seek expert advice before using it.
10. Although most cut-off saws are designed for one person operation you should always be careful not to lift beyond your own capabilities.

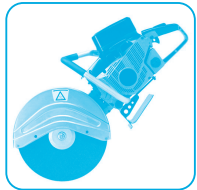

Every effort has been made by HAE/EHA to ensure that the information given in this document and supporting material is accurate and not misleading. HAE/EHA cannot accept responsibility for any loss or liability perceived to have arisen from the use of any such document/material. Only Acts of Parliament and Statutory Instruments have the force of law and only the courts can authoritatively interpret the law.

Telephone: 44 (0) 121 380 4600
Email: mail@hae.org.uk
Fax: 44 (0) 121 333 4109
website: www.hae.org.uk

Hire Association Europe
2450 Regents Court
The Crescent
Birmingham Business Park
Soliuhull B37 7YE

Hae
HIRE ASSOCIATION EUROPE

1. Check your machine, including the engine, fuel tank and guards. If anything is found to be damaged, do not use the cut-off saw. Contact the hire company.
2. Goggles and dust mask – a minimum of FFP3 protection. This equipment is likely to cause noise levels up to 93 dB(A) - wear appropriate ear muffs or plugs giving hearing protection for this level as a minimum.
3. Safety boots must be worn.
4. Hazardous. Warm hands up before commencing work, and wear industrial quality gloves to keep hands warm while working. Find out more about the effects of vibration - Ask the hire company for a copy of the HAE leaflet no. 2150 – Hand-arm vibration or visit www.hse.gov.uk/vibration
5. Anybody who is working close by will also need to wear identical personal protective equipment.
6. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
7. Make sure the guards around the wheel are in place and adjusted correctly.
8. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
9. Make sure that you understand all of the controls. Before starting the machine, know how to stop it.
10. Do not use this machine to cut asbestos or materials containing asbestos.
11. Make sure that you understand all of the controls. Before starting the machine, know how to stop it.
1. This section describes the controls and symbols found on most cut-off saws. Check the saw to find the controls before trying to start it.
2. Abrasive wheels fitted to this cut-off saw are for cutting on the edge only. Any side pressure could shatter them. Do not try to carry out any grinding work.
3. Make sure the guards around the wheel are in place and adjusted correctly.
4. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
5. Hazardous. Warm hands up before commencing work, and wear industrial quality gloves to keep hands warm while working. Find out more about the effects of vibration - Ask the hire company for a copy of the HAE leaflet no. 2150 – Hand-arm vibration or visit www.hse.gov.uk/vibration
6. Anybody who is working close by will also need to wear identical personal protective equipment.
7. Check your machine, including the engine, fuel tank and guards. If anything is found to be damaged, do not use the cut-off saw. Contact the hire company.

CONTROLS

1. The following items of personal protective equipment (PPE) are the minimum that should be worn whenever using the cut-off saw. Particular jobs or environments may require a higher level of protection.
2. Goggles and dust mask – a minimum of FFP3 protection. This equipment is likely to cause noise levels up to 93 dB(A) - wear appropriate ear muffs or plugs giving hearing protection for this level as a minimum.
3. Safety boots must be worn.
4. Hazardous. Warm hands up before commencing work, and wear industrial quality gloves to keep hands warm while working. Find out more about the effects of vibration - Ask the hire company for a copy of the HAE leaflet no. 2150 – Hand-arm vibration or visit www.hse.gov.uk/vibration
5. Anybody who is working close by will also need to wear identical personal protective equipment.
6. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
7. Make sure the guards around the wheel are in place and adjusted correctly.
8. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
9. Make sure that you understand all of the controls. Before starting the machine, know how to stop it.
10. Do not use this machine to cut asbestos or materials containing asbestos.
11. Make sure that you understand all of the controls. Before starting the machine, know how to stop it.
1. This section describes the controls and symbols found on most cut-off saws. Check the saw to find the controls before trying to start it.
2. Abrasive wheels fitted to this cut-off saw are for cutting on the edge only. Any side pressure could shatter them. Do not try to carry out any grinding work.
3. Make sure the guards around the wheel are in place and adjusted correctly.
4. Check that there are no hidden electric cables, gas or water pipes where the cut is to be made. Consider using a cable and/or pipe detector, ask the hire company for suitable types available. **Ask the hire company for HAE leaflet no.1415 – cable location and signal generator.**
5. Hazardous. Warm hands up before commencing work, and wear industrial quality gloves to keep hands warm while working. Find out more about the effects of vibration - Ask the hire company for a copy of the HAE leaflet no. 2150 – Hand-arm vibration or visit www.hse.gov.uk/vibration
6. Anybody who is working close by will also need to wear identical personal protective equipment.
7. Check your machine, including the engine, fuel tank and guards. If anything is found to be damaged, do not use the cut-off saw. Contact the hire company.

OPERATORS

CUT-OFF SAW